826-2788 Burger King Timer Kit

Intermittent ignition alarms in BK 1814 Triple Play fryers can occur during a re-light sequence after a pilot drop out. Adding an 8-second delay timer will prevent ignition alarms during the re-light sequence.

Follow these instructions to install the new delay timer:

- 1. Remove power from the unit and remove the controller.
- 2. Remove and discard the existing orange 10C wire between ignition alarm relay #1(on left) pin 1 and ignition alarm relay #2 (on right) pin 3. See Figure 1. See Figure 2 for pin positions.
- 3. Remove and discard the existing red 15C wire between ignition alarm relay #1 pin 4 and pin B.
- 4. Remove and discard the existing red 16C wire between ignition alarm relay #1 pin B (coil) and ignition alarm relay #2 pin 6.
- 5. Remove and discard the existing orange 13C wire between ignition alarm relay #1 pin 6 and ignition alarm relay #2 pin 5.
- 6. Remove and discard the existing orange 11C wire between ignition alarm relay #1 pins 5 and 6. Do not reattach the piggy back wire yet.
- 7. Remove and discard the existing orange 14C wire between ignition alarm relay #2 pins 4 and 5.
- 8. Move the orange wire from ignition alarm relay # 2 pin 3 to ignition alarm relay #1 pin 1. The other end is pin 9 of J2 on interface board. See Figure 6.
- 9. Position the provided timer relay in the bottom of the control box and using an existing hole, secure with the enclosed self taping screws. See Figures 3 and 4.



Figure 3: Use existing hole to mount timer relay.



Figure 4: Mounted timer relay

- 10. Ensure the DIP switch settings are correct. All switches should be in the OFF position except switch #4 (8 seconds). See Figure 5.
- Reattach the orange piggy back wire removed in step 6 to 11. new piggy back on enclosed new orange 10C wire. Install new orange 10C wire between ignition alarm relay #1 pin 5 (COM) to ignition alarm relay #2 pin 5 (COM). See Figure 6.

In This Kit		
Part No.	Description	Qty
805-1859	Diagram, BK1814 Control	1
809-0111	Screw, #8-32x1	1
809-0249	Nut, #8-32	1
812-2185	Timer Relay	1
W10C552	Wire 10C (ORANGE)	1
W11C543	Wire 11C (RED)	1
W1C2540	Wire 12C (WHITE)	1
819-6676	Instructions	1

Relay #1



Figure 1: Existing Wiring -Relay #1 on the left and



Figure 2: Relay **Pin Positions**



Figure 5: All dip switches should be off except #4 (8 seconds).

826-2788 Burger King Timer Kit

- 12. Install NEW red 11C wire between ignition alarm relay #1 pin B (coil) (3/16 terminal) to timer relay pin 3 (1/4 terminal). See Figure 6.
- 13. Install NEW white 12C wire between ignition alarm relay #2 pin1 (3/16 terminal) to timer relay pin 1 (1/4 terminal). See Figure 6.
- 14. Remove and replace wiring diagram on the fryer door with new enclosed wiring diagram.
- 15. Reassemble the controller and unit, return power and test operation.

