



Service Bulletin

(This bulletin and all other active bulletins are downloadable from our website at www.frymaster.com/parts_service.)

Bulletin 2004-22-ABDE

Page 1 of 1

Date: 06/15/2004

SUBJECT: Flexlines on Footprint Pro Electric Fryers

Some Footprint Pro electric fryers have had flexlines fail upon startup. This failure is associated with stresses introduced during shipment. This condition has been corrected on fryers built after 06/11/04.

When performing a startup on a Footprint Pro fryer, please carry replacement flexlines: 810-1055, an 11.5-inch line, and 810-1680, a 6.5-inch line; both are 5/8" diameter. Do not operate the filter system without inspecting the flexlines.

Check the flexlines, (see illustration below) which connect the filter pump to the oil return plumbing, for signs of stress or cracking. Replace if necessary.

