



# Service Bulletin

(This bulletin and all other active bulletins are downloadable from our website at <http://www.frymaster.com/iframe.asp?oc=fry&region=default&article=onlineliterature.xml>.)

Bulletin 2006-25-ABDE

Page 1 of 1

Date:11/15/2006

## SUBJECT: UHC-P Displays


UHC-P cabinets made between November 2005 and July 2006 may have faulty display boards. Cabinets with date codes between 0511 and 0607 can begin to beep constantly. The date range on the failure-prone displays is between 05-2005 and 07-2006. See illustrations below.

When responding to a service call involving a UHC-P cabinet with this failure, replace all the displays. Any other two or four-slot UHC-P in the store with date codes for the cabinet and the displays in the failure-prone range should have all the displays replaced as well. The problem is only found on two and four-slot units. Displays in the narrow cabinet do not exhibit this failure.

UHC-P cabinets are differentiated most readily from older units by the black disk opposite the power switch on the front of the unit. These units are programmed with a Palm Pilot. Older UHC cabinets, which are programmed on the display, do not exhibit this problem and a failure on an older unit doesn't necessitate replacing all the display boards.

ASA's should check their stock of UHC-P displays for the affected date range and return the potentially flawed units. Also, order 16 additional new displays (807-4201, \$240 List) or more if your market area has a high population of UHC-P cabinets.

All replaced UHC-P display boards must be returned to Frymaster.

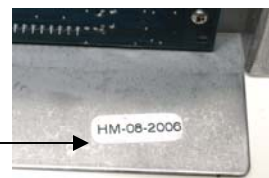

**Figure 1:** Date code on a UHC-P display. Displays dated after 07-2006 do not need to be replaced.

Frymaster L.L.C., 8700 Line Avenue, P.O. Box 51000, Shreveport, LA 71135-1000

Shipping Address: 8700 Line Avenue, Shreveport, LA ZIP 71106

TEL 318-865-1711

FAX 318-219-7135

24-Hour SERVICE HOTLINE 800-551-8633

WebSite - <http://www.frymaster.com/general.asp?article=servicehome.xml>

E-mail - [service@frymaster.com](mailto:service@frymaster.com)