



Service Bulletin

(This bulletin and all other active bulletins are downloadable from our website at <http://www.frymaster.com/iframe.asp?oc=fry®ion=default&article=onlineliterature.xml>.)

Bulletin 2006-27-ABDE

Page 1 of 1

Date: 12/6/2006

SUBJECT: Mercury Contactor Recall

Frymaster received a limited number of mercury contactors that could fail due to ceramic particle problems. These contactors are in new E4 model electric fryers; service contactors could have been installed in earlier model electric fryers.

Please inspect your inventory (including truck inventories) for 807-1071 contactors with date codes between 927393 and 937893. These should be returned as soon as possible to Frymaster and replacements ordered.

Please inform your service technicians and associate servicers that E4 model fryers manufactured in July and August 2006 could experience contactor failure, leading to overheating or tripping the hi-limit.

In fryers exhibiting overheating problems, check all the contactors and replace them if the date code falls between 927393 and 937893.

Frymaster L.L.C., 8700 Line Avenue, P.O. Box 51000, Shreveport, LA 71135-1000

Shipping Address: 8700 Line Avenue, Shreveport, LA ZIP 71106

TEL 318-865-1711

FAX 318-219-7135

24-Hour SERVICE HOTLINE 800-551-8633

WebSite - <http://www.frymaster.com/general.asp?article=servicehome.xml>

E-mail - service@frymaster.com