



Service Bulletin

(This bulletin and all other active bulletins are downloadable from our website at <http://www.frymaster.com/iframe.asp?oc=fry®ion=default&article=onlineliterature.xml>.)

Bulletin 2007-27-ABDE

Page 1 of 1

Date: 10/05/2007


SUBJECT: Defective High-limit Thermostat

Due to vendor error, a number of high-limit snap disc thermostats have been found to be defective. The ½" NPT male threads are too large and will not properly seal in the ½" NPT couplings. The defective high-limit thermostats will only screw into a ½" NPT coupling approximately ¾ of a turn by hand. A good high-limit will screw into a ½" NPT coupling a minimum of 3 turns by hand.


ASA's that received parts shipped from Frymaster from September 18, 2007 through and including October 1, 2007 need to check their stock of service high-limit thermostats listed below to ensure that all high-limits screw into a ½" NPT coupling a minimum of 3 turns **by hand**. Defective high-limits have been found with date codes of 0738 and 0739. The date code is the four digit number that follows "807-2274" on the end of the thermostat.

Service Parts Kits Containing Defective High-limits:

826-2455
826-2457
826-1177
826-2457
806-7541
806-9708SP

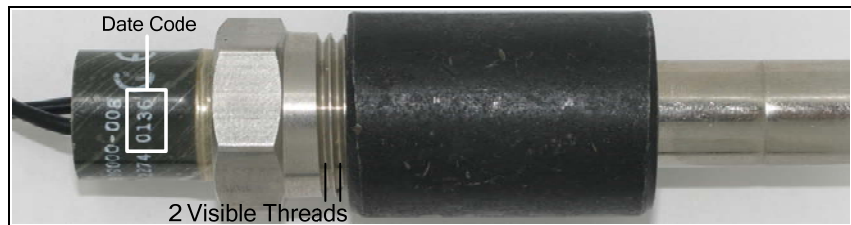

"Good" part.

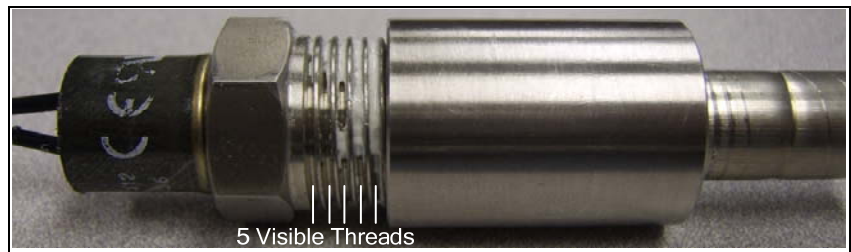

"Defective" part.

Defective high-limits should be sent back to Frymaster for credit and replacement.

Frymaster L.L.C., 8700 Line Avenue, P.O. Box 51000, Shreveport, LA 71135-1000

Shipping Address: 8700 Line Avenue, Shreveport, LA ZIP 71106

TEL 318-865-1711 FAX 318-219-7135 24-Hour SERVICE HOTLINE 800-551-8633

WebSite - <http://www.frymaster.com/general.asp?article=servicehome.xml>

E-mail - service@frymaster.com