

Service Bulletin

Subject: Electric Contactor Box Transient Voltage Suppression Harness

Models: All Electric Touch Screen Fryers

10/05/2022

Frymaster **ELECTRIC** Touch Screen Fryers with serial numbers **prior to 2206**, may experience issues with the touch screen controller randomly rebooting and/or SIB (Smart Interface Board) errors, due to electromagnetic interference.

If a fryer is exhibiting these symptoms, attaching an intermediate transient voltage suppression harness (see Figure 1), between the contactor box and contactor box harness will address these issues. Units built 2206 and after have the upgrade integrated into the contactor box assembly (noted by the sticker on the box).

If a fryer has these issues, order enough 8263720 kits for each contactor box in the affected fryer. If more than one fryer is in a store, order enough kits to address both fryers in the store.

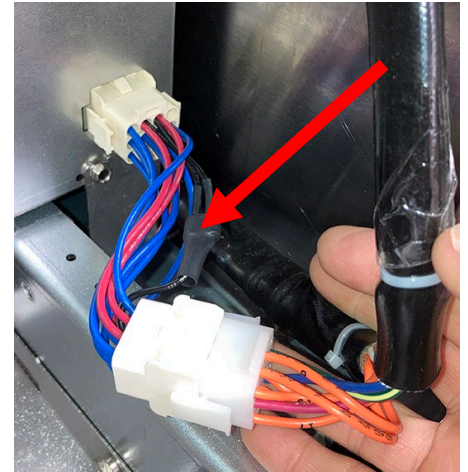


Figure 1 Box prior to 2206 with harness added.

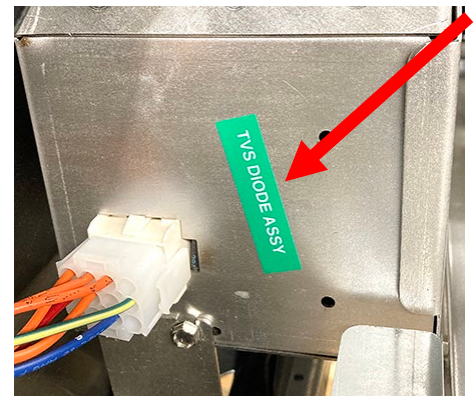


Figure 2 Box 2206 and after with upgrade integrated into the contactor box assembly.