

Service Bulletin

This bulletin addresses new improved braided flexline replacements.

Subject: Improved Braided Flexline Replacements

Models: Fryers with Filtration

10/2/2025

New improved braided flexlines should be used as a replacement for failed lines between the filter pump and the return oil manifold. These are more resilient to vibration when in transit and during filter operations.

Below are the new improved braided flexlines that should be stocked to replace a damaged flexline.

130252972 FLEX LINE BRAIDED 5/8" ID X 12.00 LONG

130252974 FLEX LINE BRAIDED 5/8" ID X 14.00 LONG

If the filter pump motor has vibration isolators installed, the isolators **MUST** be removed and replaced with 1/4"-20 x 1" long bolts with locking nuts.

Whenever replacing flexlines, use a backup wrench on the adaptor to prevent loosening and torsional twisting of the flexline.

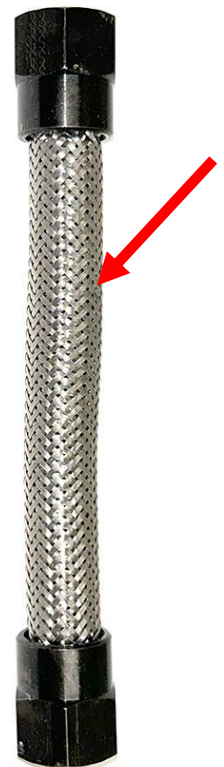


Figure 1