FRYMASTER
8700 LINE AVENUE, SHREVEPORT, LA 71106

800-551-8633
318-865-1711
WWW.FRYMASTER.COM
EMAIL: FRYSERVICE@FRYMASTER.COM

Service Bulletin

This bulletin addresses an issue where McDonald's Intuition MIE314 fryer cord, manufactured with serial #'s prior to 2610, may interfere with the receptacle.

Subject: McDonald's Intuition MIE314 Cord set Impingement

Models: Frymaster McDonald's MIE314 Intuition Electric Fryers with serial numbers prior to 2610.

10/1/2026

Some McDonald's MIE314 Intuition electric fryers middle cord position, may interfere with the receptacle on the race way, that **use universal hoods** (see Figure 1).

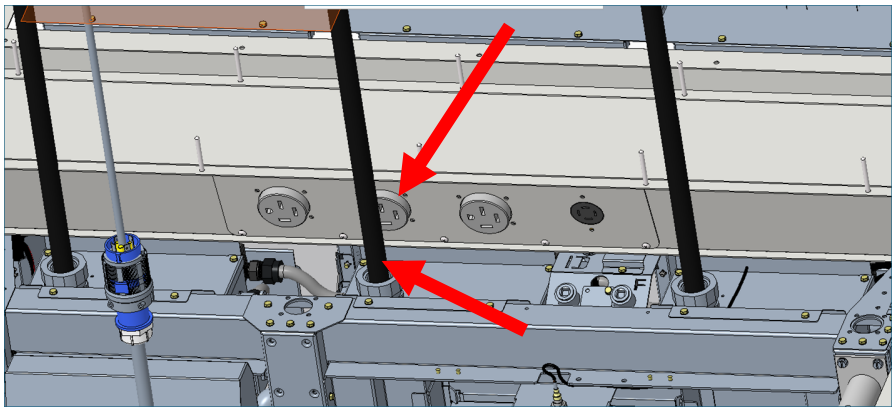


Figure 1

If this occurs, the solution is to remove the four (4) screws that attach the middle cord set box (see Figure 2).

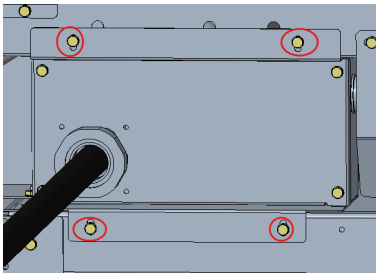


Figure 2

Slide the cord set box approximately 2-inches towards the left, as viewed from the rear of the fryer (see Figure 3).

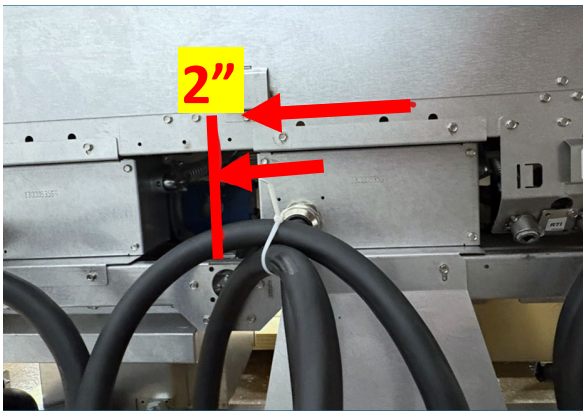


Figure 3

Reattach using self-tapping screws (see Figure 4).

This should be addressed during startup of any new McDonald's MIE314 electric fryers with serial # prior to 2610.

Any existing locations should be contacted to schedule a visit to address this issue.

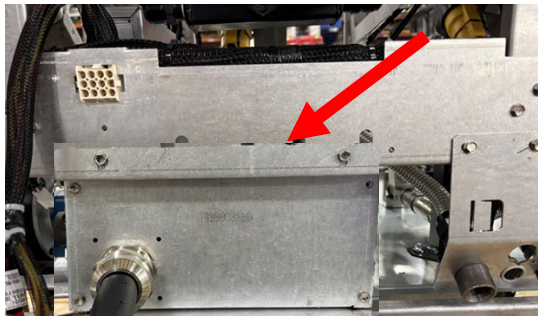


Figure 4