

Instruction Sheet

Follow these instructions to update software, menus or settings on Intuition Fryers.

Subject: Intuition Update Files Instructions

Models affected: Intuition FQIG30, MIG30, FQIE30 and MIE14 Fryers

10/14/2025

1. Use a blank USB drive.
2. Right click and click New and then click Folder




3. Name the folder **welbilt** and press enter.




4. Double click on the welbilt folder to open the folder.
5. Right click inside the welbilt folder and click New and then click Folder




6. Name the folder **package** and press enter.

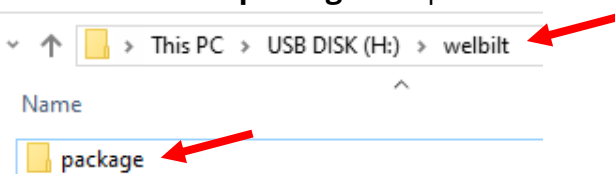

7. Double click on the package folder to open the folder.
8. Drag the update file into the package folder. The file should **ALWAYS** be .tar format.

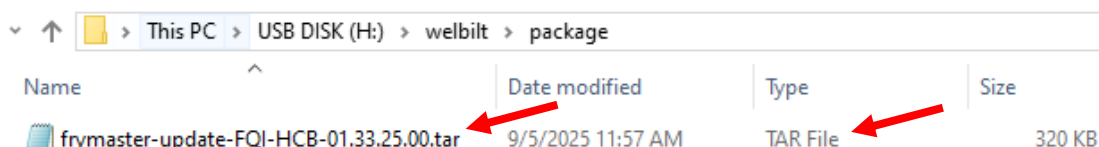

9. Right click on the USB drive with the files and click on eject the drive.

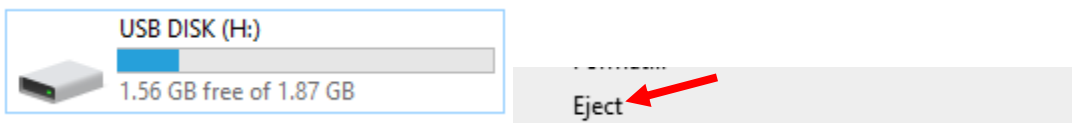

10. Press the **i** Information button.
11. Press the **Software** tab.
12. Take a photo of the software versions before proceeding.
13. Press the Configuration tab.
14. Take a photo of the Menus and Settings versions before proceeding
15. Ensure the controllers are turned OFF (see Figure 1).

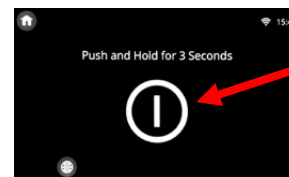


Figure 1

16. After several seconds a drop-down arrow should appear in the upper right corner (see Figure 2).
17. Press the drop-down arrow button (see Figure 2).
18. Press the **X** button to exit.
19. Follow the instructions to update fryer.
20. Press the **Service** button.
21. Press the **Update Software** button.
22. Enter passcode **3000** for Non-McDonald's or **1650** for McDonald's.
23. The fryer should begin updating files. If a software update error occurs, press the check and continue.
24. Once it's finished it should reboot.
25. After it reboots, remove the USB and hard power cycle the entire fryer battery for at least 60 seconds or longer using the master power reset switch.
26. Press the **i** Information button.
27. Press the **Software** tab.
28. Ensure the software is updated.
29. When updating settings or menus, press the **Configuration** tab and ensure the menus or settings have updated.



Figure 2