

Service Bulletin

Subject: UHC-HD Software Revision

3/8/ 2019

The software on the McDonald's UHC-HD has been revised, updated from version 1.52 to 1.53. The software is on new cabinets shipped after 12/18.

The revision is introduced in older cabinets when a service master control board replaces an earlier 1.52-equipped board or the store personnel updates the cabinet with a software service kit.

It's an enhancement for stores with all-day breakfast offerings.


The 1.53 version changes the way the cabinet behaves when the programming button on the master control is pushed. Press the button and the cabinet produces displays on the top left cabinet bezels: Modes and Program (see above).

Previously, pressing the program button on the master control produced a scrolling message on the master display to enter a programming code. That same message scrolls with the new software if the button on the bezel displaying Program is pushed.

Pressing Modes on the bezel display allows the cabinet to be switched from Breakfast to Lunch, etc., with one additional button push.

Also, with the new software:

- Slot positions won't display Lo/Hi Temp during menu transition, allowing timers to start.
- Slot position temperatures immediately go to the new temperature in the transition, not waiting on existing timers to time down.
- Slot positions without active timers immediately show the new menu item after transition.

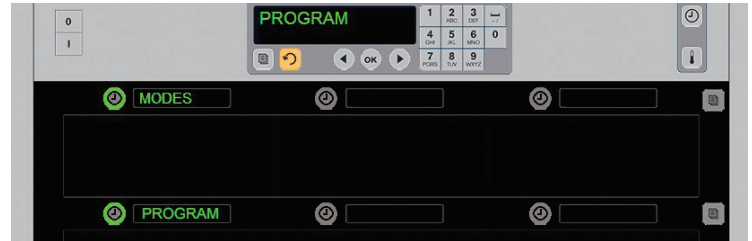

A UHC-HD cabinet with 1.53 software is shown with the Programming button pushed. Modes and Program are displayed on the top two bezels.

Software Check

- Turn cabinet off and back on.
- Software version is shown on Master Display.

OR

- Press program button; enter 090809 as Master Display scrolls enter programming code.
- Version is displayed on Master Display.